

City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

Strawberry Run Condition Assessment

PREPARED FOR: City of Alexandria, CH2M Hill
PREPARED BY: Michael Baker Jr., Inc.
DATE: February 14, 2014 (Revised May 26, 2015)

Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within Strawberry Run was completed. In total, 127 storm sewer structures were inspected. This included 43 manholes, 66 inlets, and 18 I/O structures. In addition, 209 storm sewer pipe segments were inspected. This Technical Memorandum summarizes the results of the field investigations in the Strawberry Run watershed.

The inspections were performed by Video Pipe Services (VPS) using the “Lamping” technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined space inspection procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at ground level of a storm structure and screen the structure and its connecting pipes for defects. The lamping technique is a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted. In addition to visually inspecting the stormwater structures and pipes, field crews from VPS obtained the size and invert measurements of storm pipes.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in Strawberry Run for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (less than 1%) of the total storm infrastructure length in Strawberry Run. The results of the condition assessment of the CMP inspections will be provided in a separate memorandum.

The storm sewer structures and pipes were inspected utilizing the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established in SCREAM for different conditions of sewer facilities along with corresponding ranges for each defect category. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating.

Table 1 – SCREAM Defect Categories

Defect Category	Score Range	Example
None	0	n/a
Few	1-20	Infiltration weeper
Minimum	21-40	Manhole cracks less than 1/8"
Moderate	41-60	Spalling of chamber wall, large infiltration flow
Major	61-80	Large cracks in cover or frame
Extreme	81-100	Collapsed Pipe

Structure Inspections

As part of this inspection task, 127 storm structures were inspected in the Strawberry Run watershed. Figure 1 shows the number of structures within each defect category identified in the previous section. Figure 2 shows the geographic location of each structure within the Strawberry Run watershed, color coded to its defect category. The average condition score of the storm structures was 41 (Moderate). Eighteen (18) structures (14%) scored 61-80, placing them in the major category. About 67% of Strawberry Run structures ranked in the minimum to moderate defect categories with scores of 21 to 60. Two (2) percent of the Strawberry Run structures were rated 1-20 (Few), and the remaining 17% percent of the structures had no observed defects.

The highest total structure score in Strawberry Run was 76 (pictured in Figure 10). Therefore, no single structure had enough defects to rank in the overall “Extreme” category.

There were eleven (11) structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field). Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

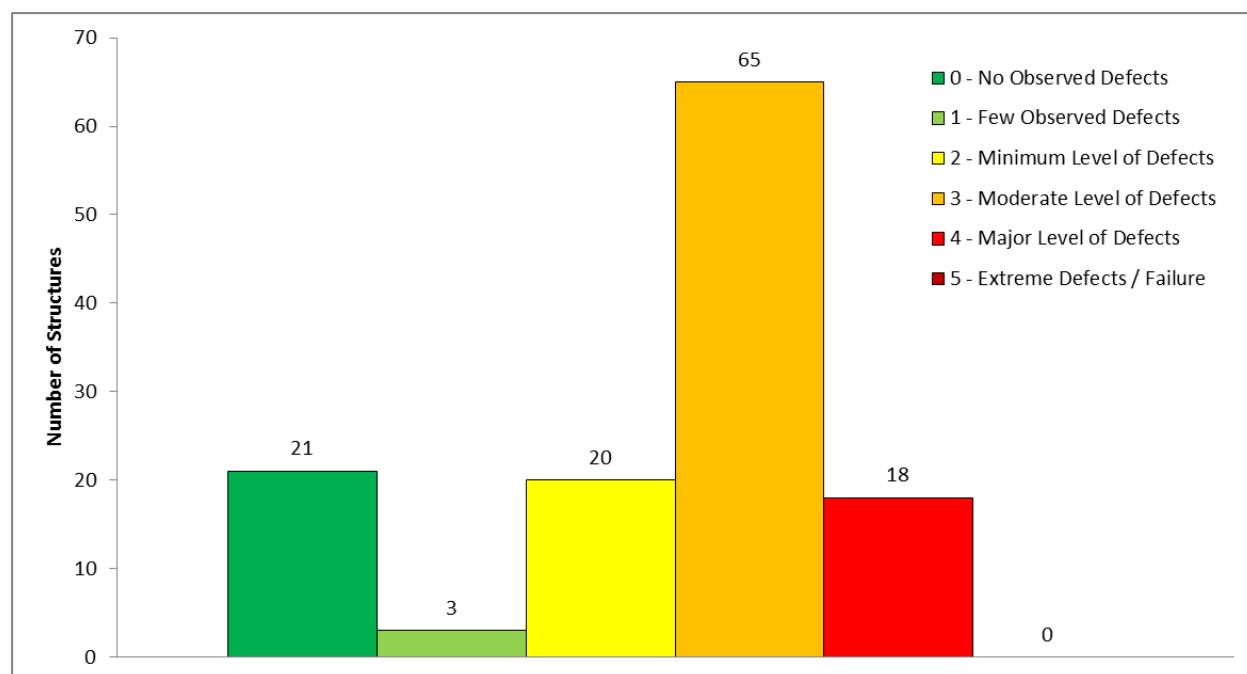


Figure 1. Structure Inspection Summary.

Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).


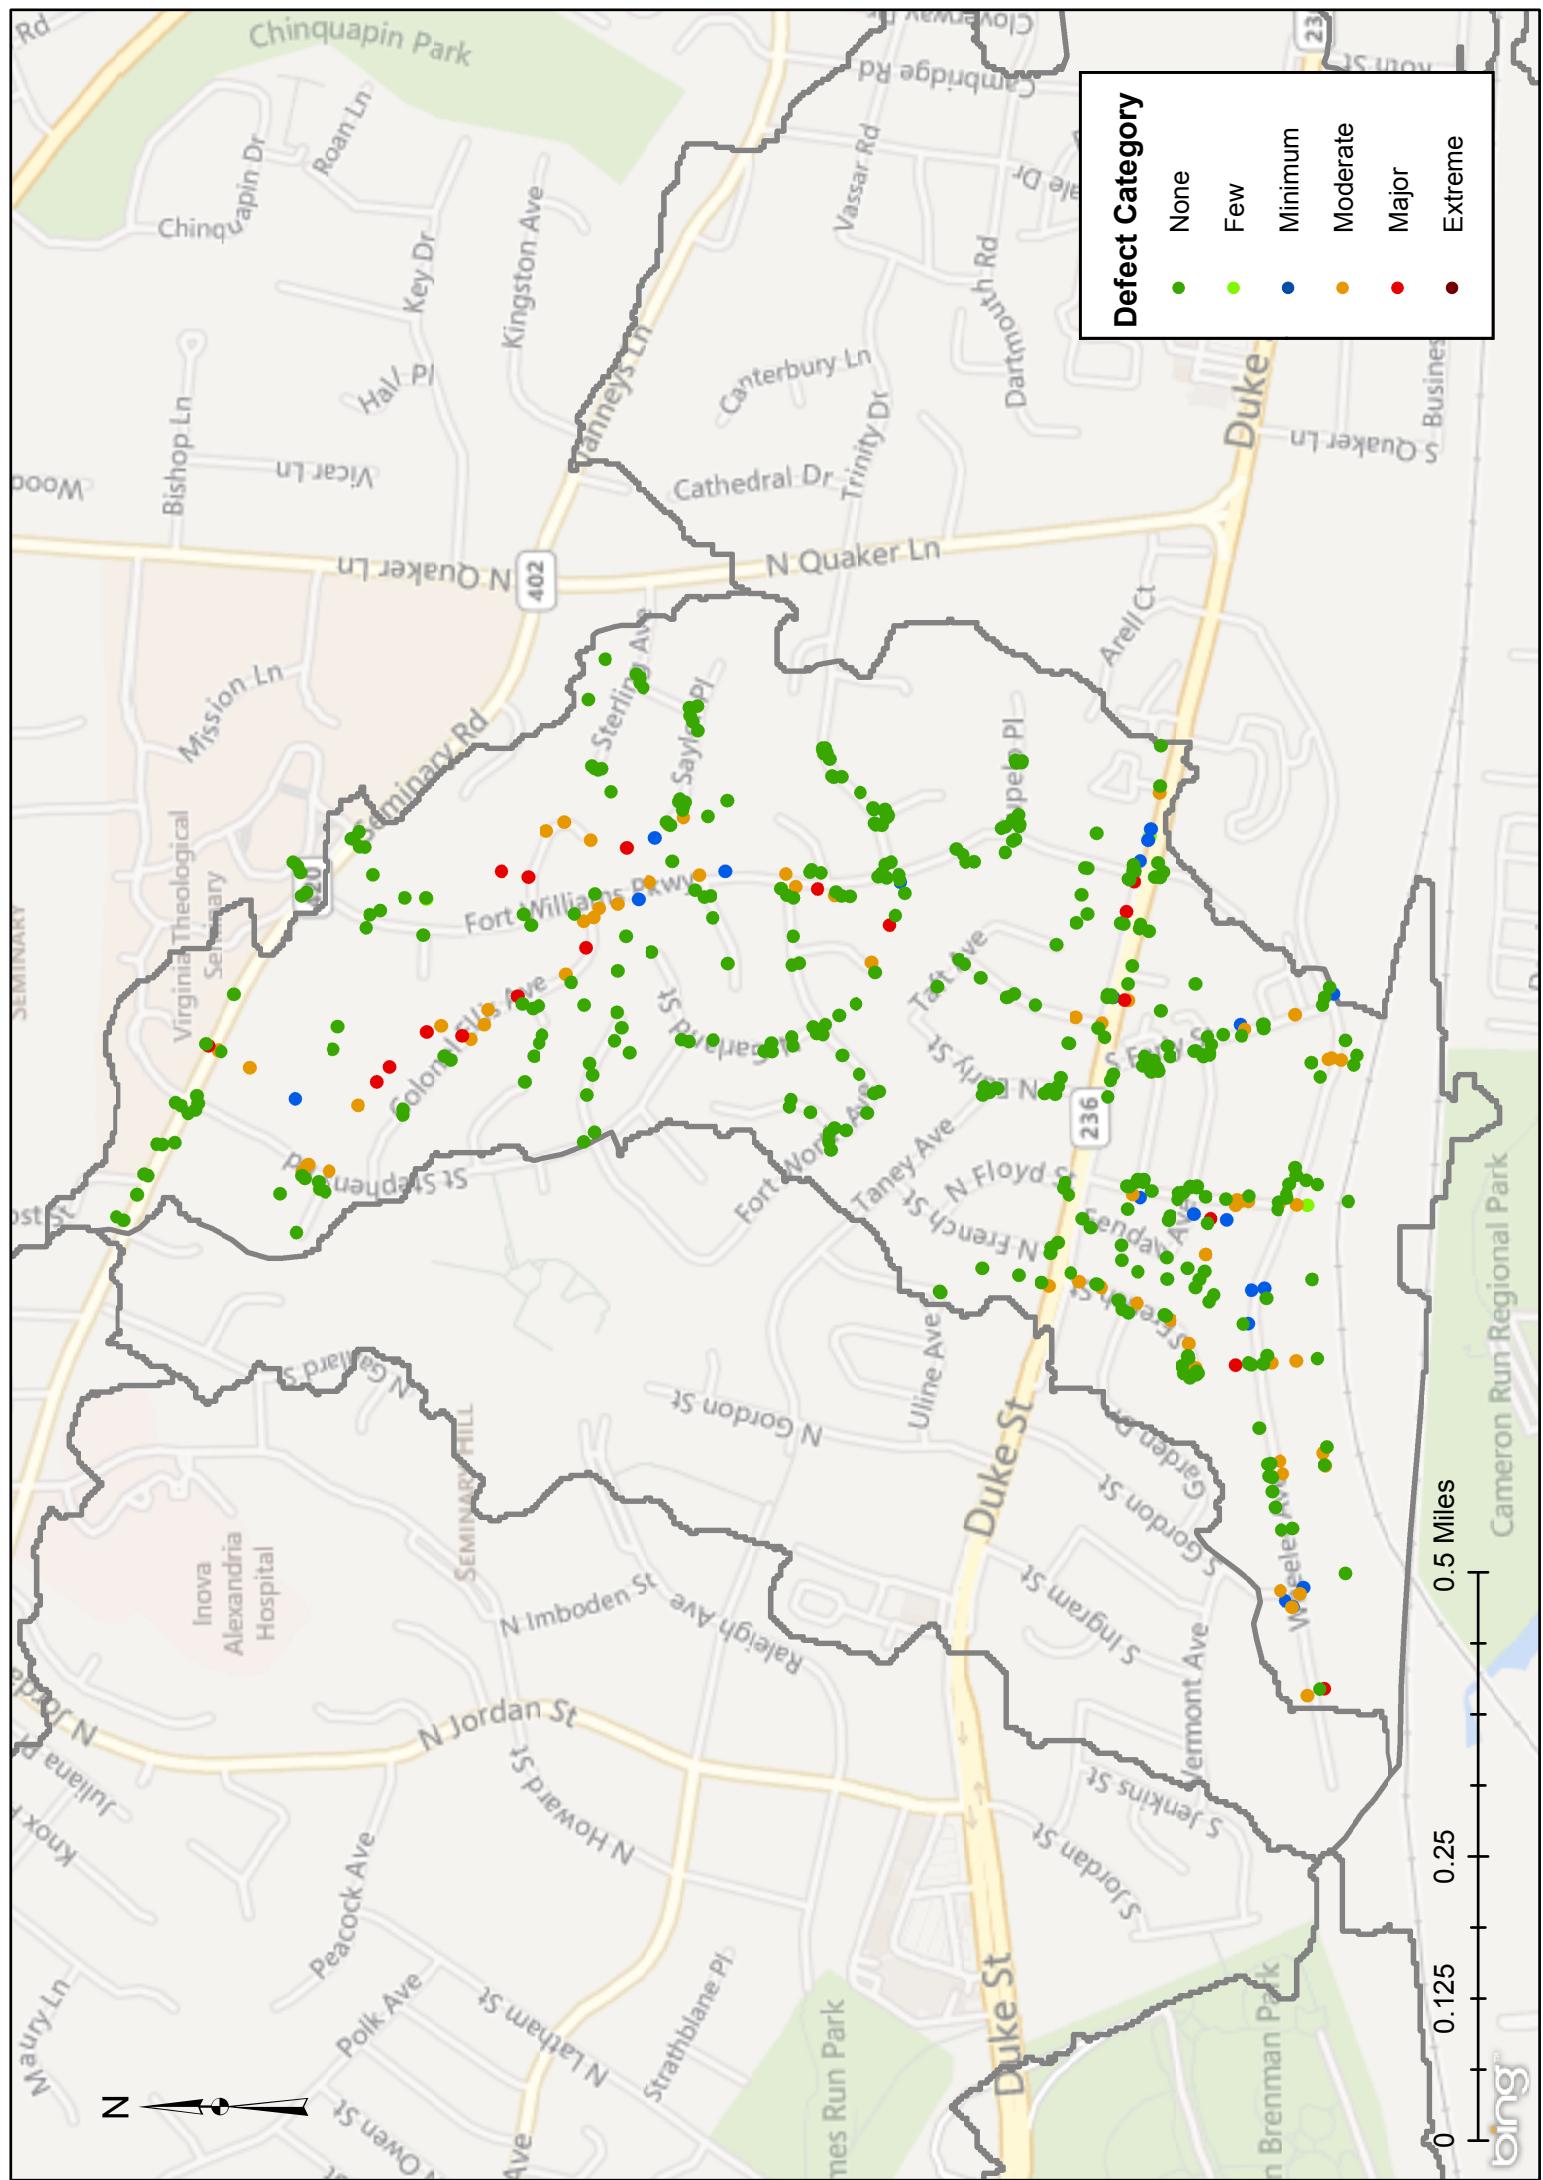


Figure 3 displays the location of the structures classified with major damage only. No extreme defects were observed within Strawberry Run watershed. Most structures with high defect scores are located along Fort Williams Parkway and Colonel Ellis Avenue. For further detailed condition assessment, the inspection results of the structures were broken down by structure component. Table 2 lists the number of observed defects by component and severity. Note that the table shows a count of the number of defects found in each component and their respective severity across all structures, not the number of inspections performed. Multiple defects may be found in a single component of a structure.

Table 2 - Count of Structure Inspection Observations by MH Component and Severity

Structure Component	Min	Mod	Maj	Extreme
Cover	-	-	-	-
Frame	4	3	1	-
Frame Base Seal	61	16	1	-
Chimney/Shaf	71	-	-	-
Chamber	227	53	12	-
Bench	4	5	-	-
Steps	-	-	1	-
Channel	2	6	6	3
Pipe Connection	42	4	2	2

Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).

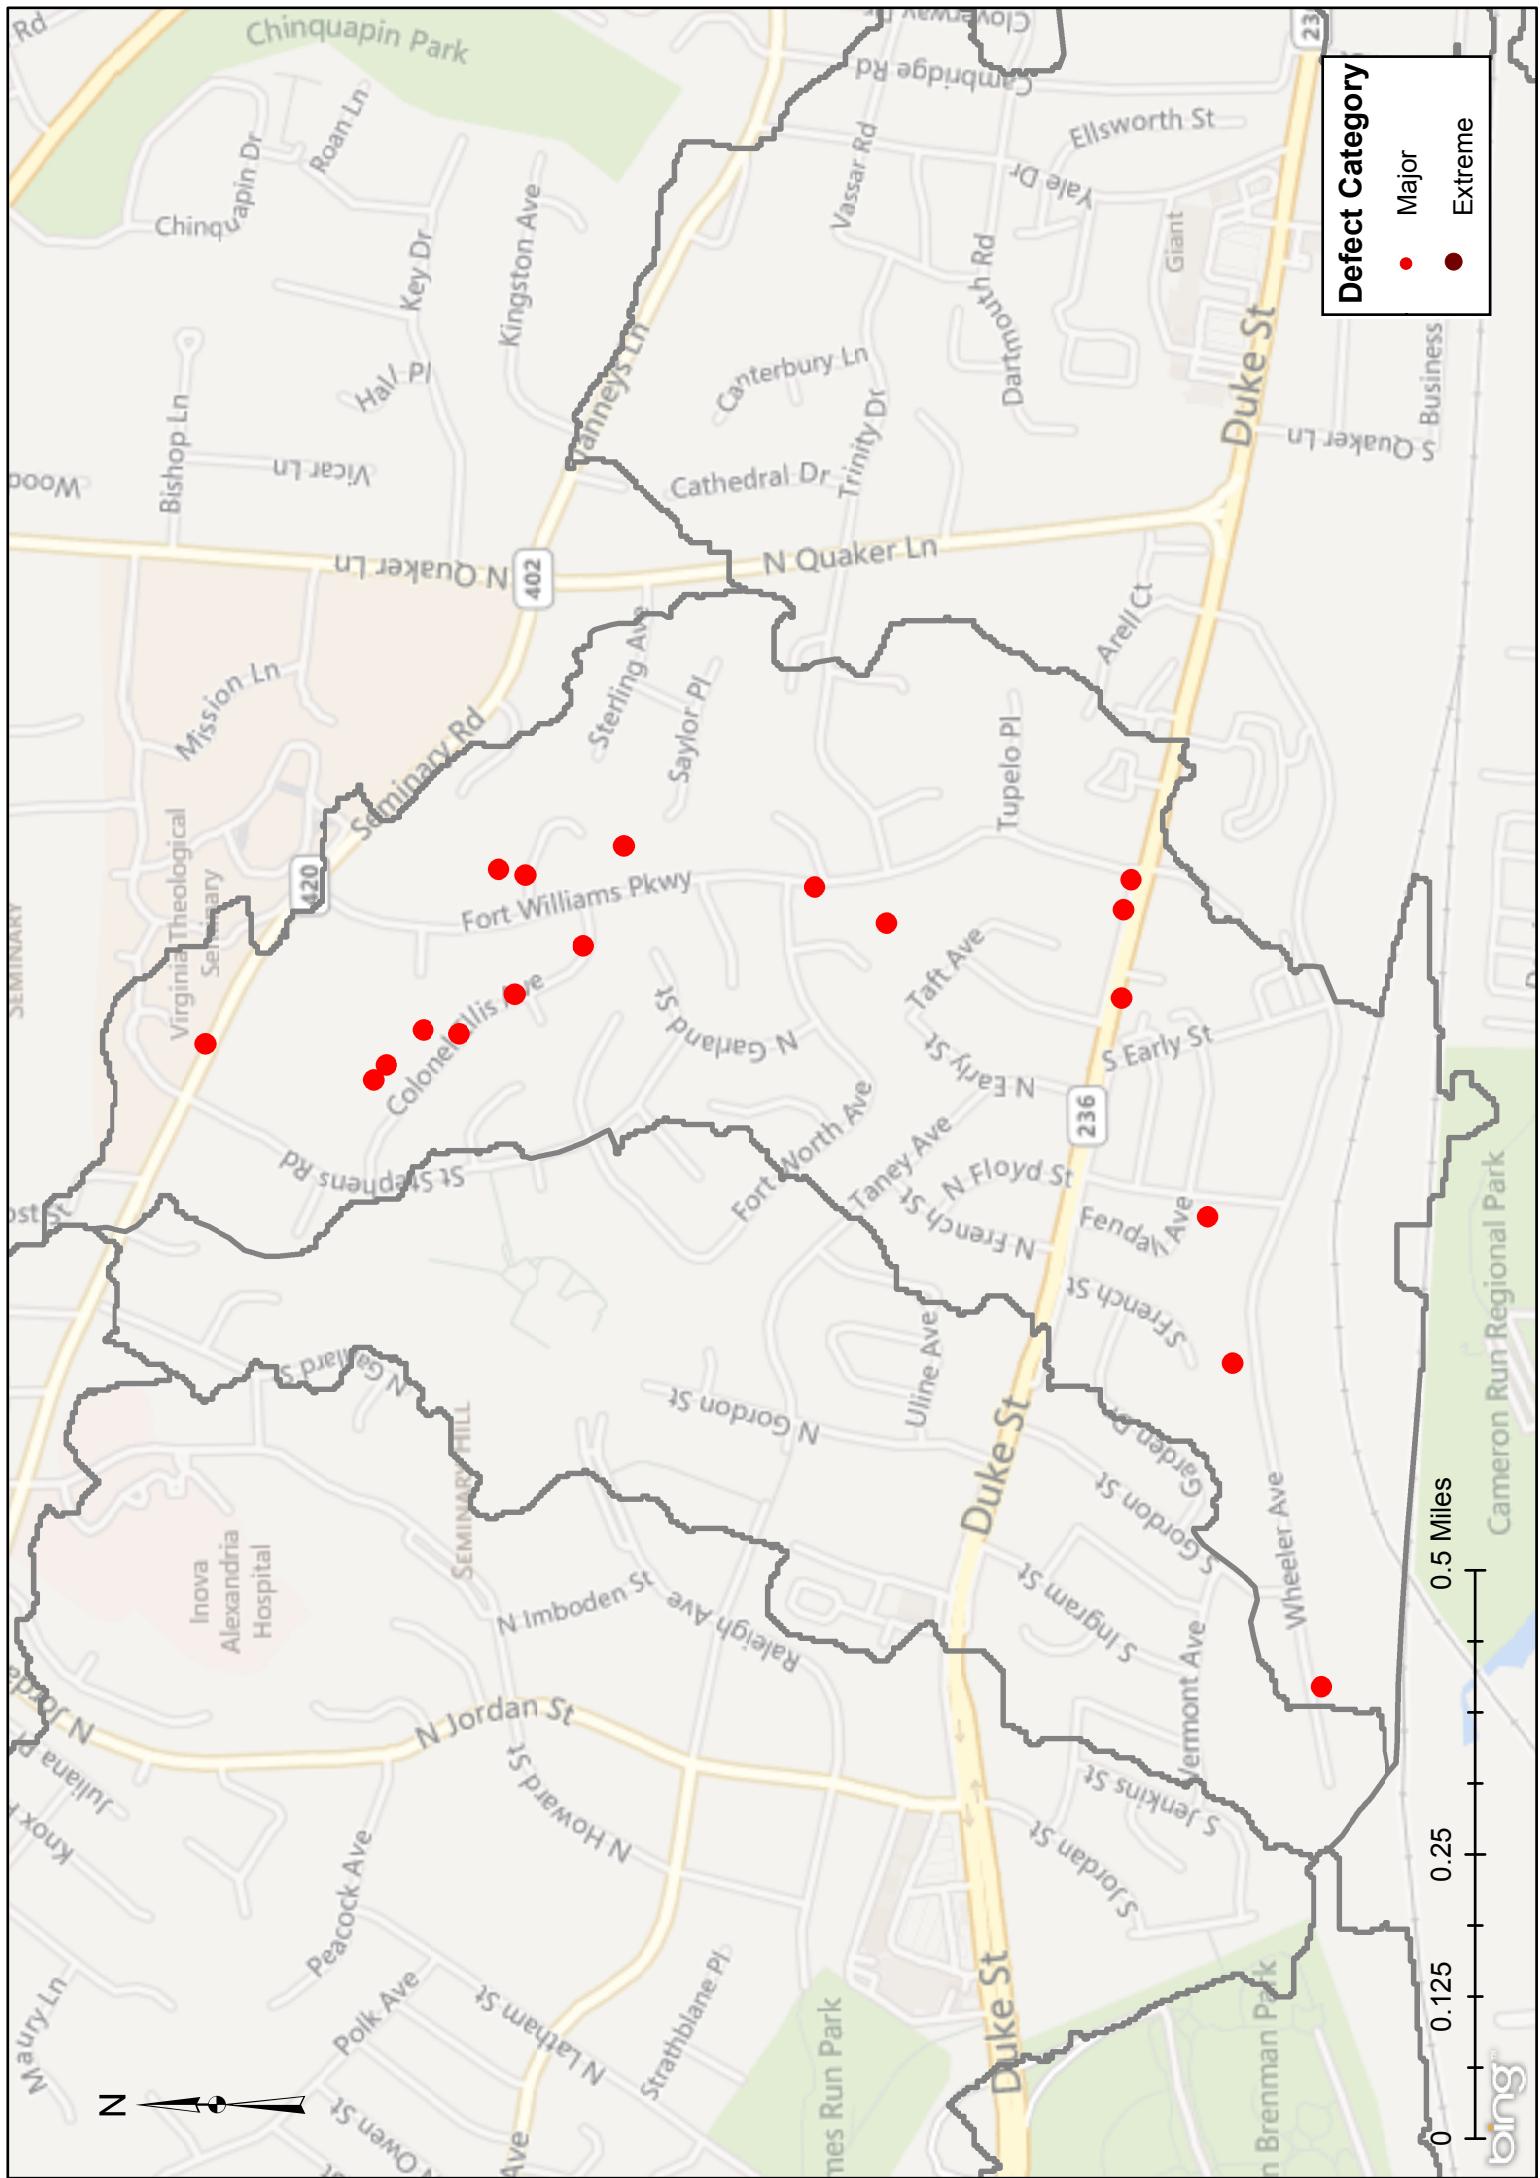


Observed defects of lower severity (Minimum and Moderate defect categories) were frequently associated with the chamber, chimney, frame base seal, and pipe connection components. Twenty-three (23) instances or occurrences of major defects were observed in the Strawberry Run structures, and five (5) extreme damage occurrences were recorded. The covers of the inspected structures in Strawberry Run were observed to be in good condition, with no recorded instances of cracking or corrosion.

Examples of problems in the moderate category for the frame base seal, and chamber are shown in Figures 4 and 5, respectively.



**Figure 4. Moderate Frame Base Seal Damage on Structure 000413SMH
(Overall SCREAM Score = 61).**

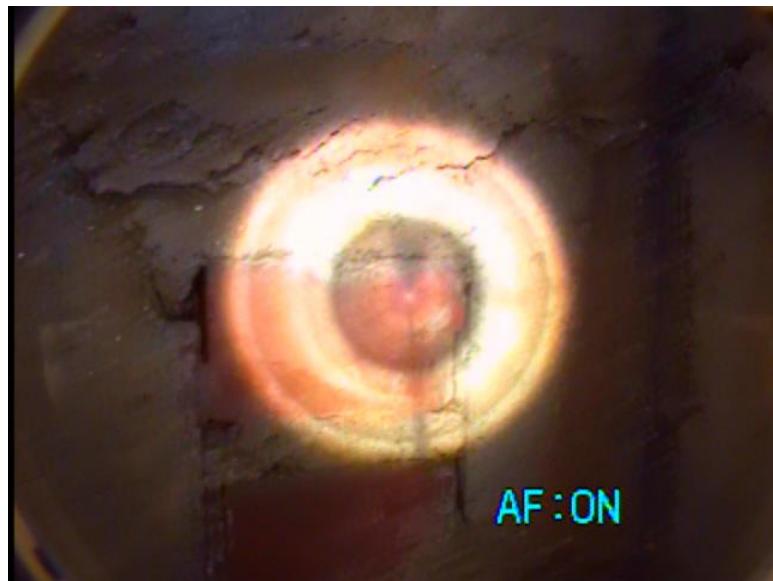

**Figure 5. Moderate Chamber Wall Damage on Structure 000612SMH
(Overall SCREAM Score = 60).**

The problems in the major category were most frequently associated with the chamber areas. Cracks in the chamber between 1/8" to 1/4" in width, for example, are considered major damage. Settled debris in the manhole also contributes to the overall score; 3-5 gallons of debris present in the channel ranks in the major range of defects. Figures 6 and 7 are examples of major damage to the chamber wall and manhole channel.



**Figure 6. Major Damage to Chamber Wall in Structure 001342IN
(Overall SCREAM Score = 56).**



**Figure 7. Major Channel Debris in Structure 000616SMH
(Overall SCREAM Score = 57).**

The problems in the component extreme category were associated with the manhole channel (3 instances) and pipe connections (2 instances). Generally, this involved either large amounts of settled debris (more than about five gallons), large cracks in the concrete (larger than $\frac{1}{4}$ inch), or spalling and etching (25% to 50% material loss). Infiltration associated with the cracks (inflow higher than about 10 gpm) is also ranked in the extreme category of defects. Figures 8 and 9 are examples of problems in the extreme category in manhole channels; figures 10 and 11 are problems associated with the manhole pipe connections.



**Figure 8. Heavy Debris in Structure 000609SMH
(Overall SCREAM Score = 67).**



**Figure 9. Channel Damage at Structure 000118IO
(Overall SCREAM Score = 39).**



**Figure 10. Damaged Pipe Connection in Structure 002870IN
(Overall SCREAM Score = 69).**



**Figure 11. Infiltration at Pipe Connection in Structure 002875IN
(Overall SCREAM Score = 76).**

Appendix A: Structure Inspection Summary provides a summary of the total SCREAM defect score of each storm structure, and Appendix B: Structure Inspection Report provides a detailed report of the defects associated with each inspection.

Pipeline Inspections

In total, 209 storm sewer pipe segments were inspected in the Strawberry Run watershed. Figure 12 shows the number of pipe segments within each defect category. Figure 13 shows a map of the location of each inspected pipeline, color coded by the defect categories identified previously in the memorandum. It is noted that the majority of the defects observed were on storm pipe segments along Colonel Ellis Avenue. The average condition score of the storm pipe segments inspected within the Strawberry Run watershed was 2.0 (Few to No defects). Inspection results in Strawberry Run showed that the pipe segments were observed to be in generally good condition, with no defect observed in 85% of the pipes.


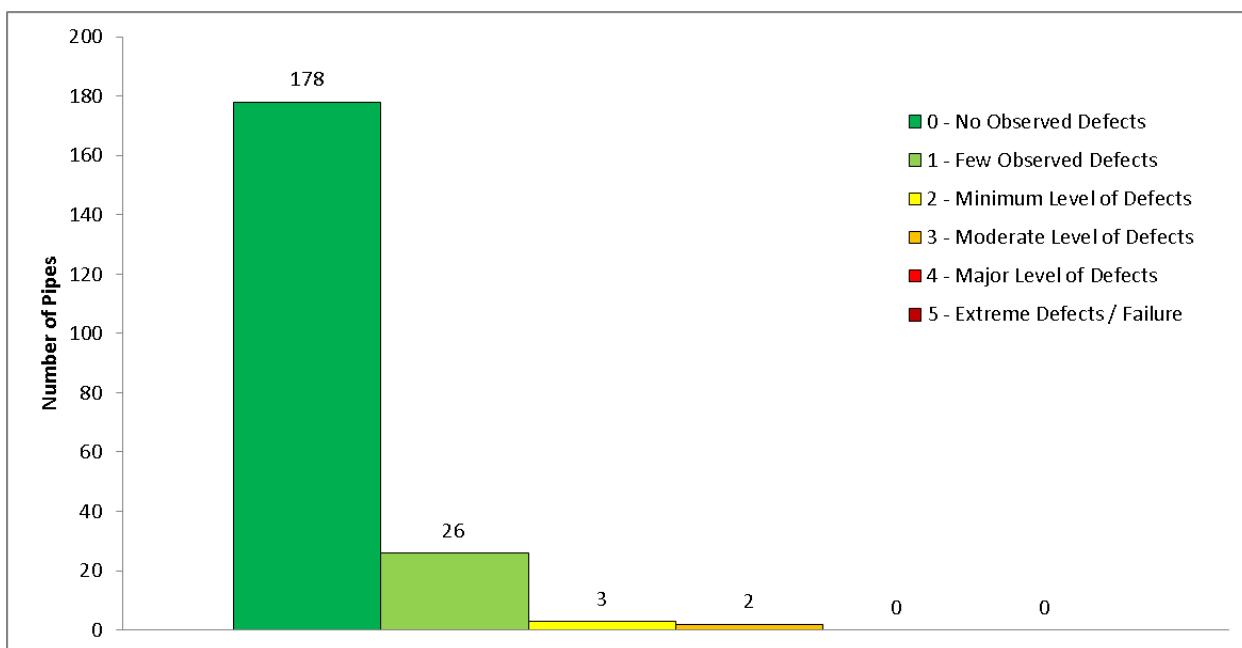



Figure 12. Pipe Lamping Inspection Summary.

Figure 13. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).

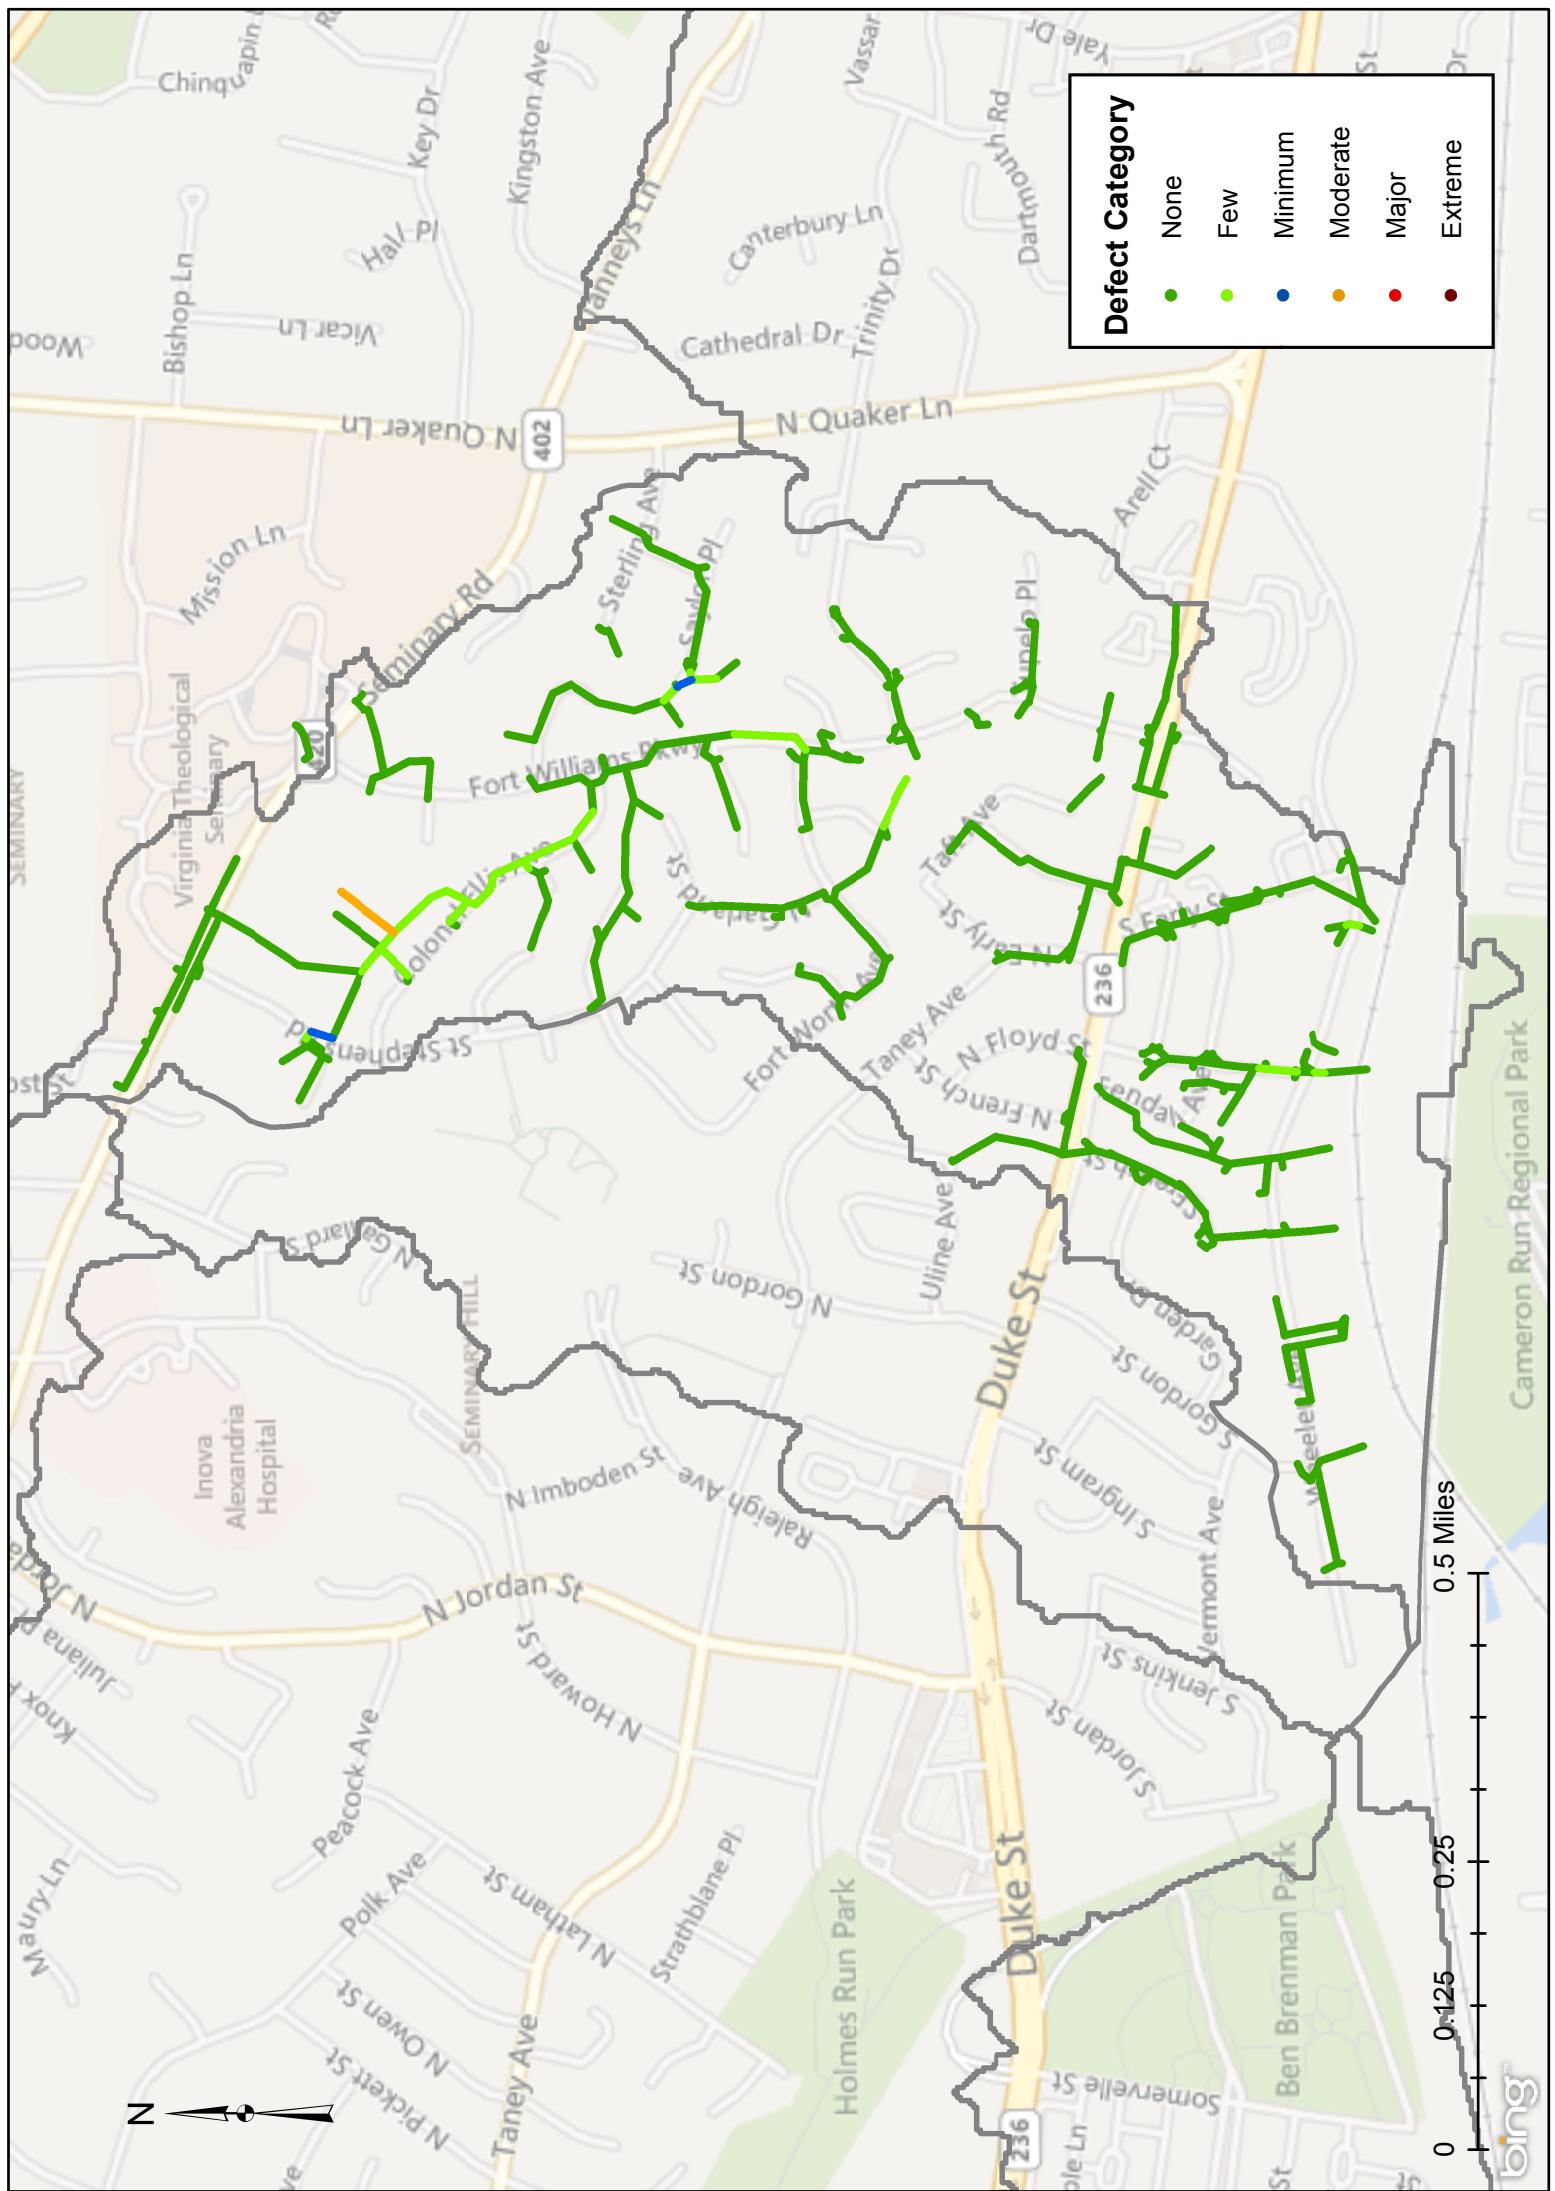

The following images captured during the lamping inspections show typical defects observed within Strawberry Run storm pipes. Figure 14 shows evidence of low levels of infiltration (less than 1 gpm) inside a 36-inch pipe. This segment has an overall SCREAM score of 7 (Few defect category), indicating relatively low level of damage. Figure 15 is an example of multiple longitudinal cracks and slightly higher levels of infiltration (between 1 and 3 gpm); this 42-inch diameter segment has an overall SCREAM score of 32 (Minimum). The 36-inch storm pipe in Figure 16 has an overall SCREAM score of 47 (Moderate), due to settled debris and an offset joint of 2-3 inches. Figure 17 is a photograph of a broken 21-inch pipe with an overall SCREAM score of 60 (Moderate), the highest in Strawberry Run. Note that the photograph of the damaged pipe connection in Figure 10 corresponds to the broken pipe in Figure 17.

Appendix D: Summary of Observed Pipe Defects lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.

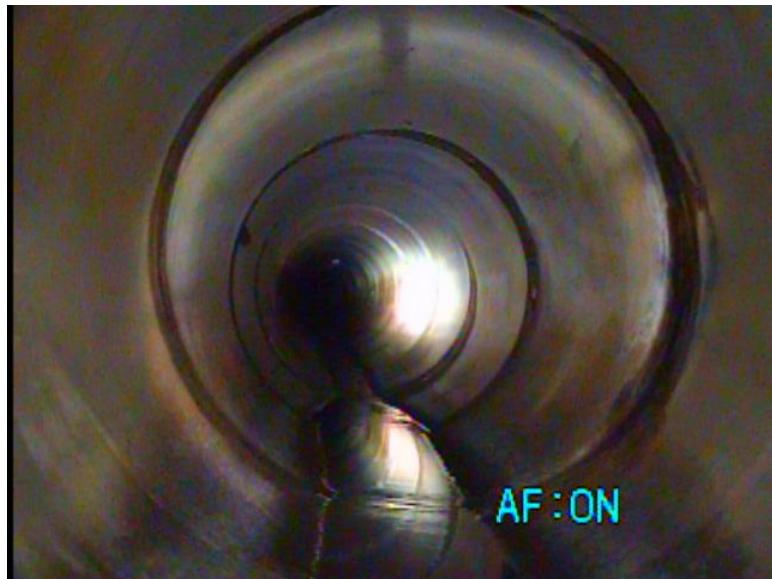

**Figure 14. Low Infiltration in 36-in Storm Pipe between Structures 000891SMH and 002870IN
(Overall SCREAM Score = 7).**



**Figure 15. Multiple Cracks & Infiltration in 42-in Storm Pipe between Structures 001285IN and 001282IN
(Overall SCREAM Score = 32).**



**Figure 16. Settled Debris and Displaced Joint in 36-in Storm Pipe between Structures 000885SMH and 000887SMH
(Overall SCREAM Score = 47).**



**Figure 17. Broken 21-in Storm Pipe between Structures 002889IN and 002870IN
(Overall SCREAM Score = 60).**

Summary

In total, 127 storm sewer structures and 209 associated pipeline segments were visually inspected for defects and damage using the lamping technique. Overall, the storm sewer infrastructure within the Strawberry Run watershed is in decent condition. The storm sewer infrastructure along Colonel Ellis Avenue in particular had worse condition scores than the rest of the shed. The average SCREAM condition score for the storm structures was 41 (Moderate) and the average condition score for pipe segments was 2 (Few). None of the pipe segments and zero manholes inspected had observed defects in the extreme category (scores 81-100).

Appendix A – Structure Inspection Summary

(Sorted by Defect Score)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Total MH Score

Alexandria - Strawberry Run

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	002875IN	X	3913	COLONEL ELLIS AV	Sidewalk	05/20/2013	Truck 1	Complete Inspection	76	77	0		3
Strawberry	000433SMH	X	519	FT WILLIAMS PY	Easement	05/17/2013	Truck 1	Complete Inspection	74	75	0		2
Strawberry	002896IN	X	3729	TEMPLETON PL	Easement	05/17/2013	Truck 1	Complete Inspection	70	69	5		1
Strawberry	002870IN	X	3929	COLONEL ELLIS AV	Yard-Back	05/20/2013	Truck 1	Complete Inspection	69	70	0		3
Strawberry	000609SMH	X	97	FENDALL AV	Yard-Side	06/27/2013	Truck 1	Complete Inspection	67	39	50		3
Strawberry	000891SMH	X	3929	COLONEL ELLIS AV	Yard-Back	05/29/2013	Truck 1	Complete Inspection	66	67	0		3
Strawberry	002871IN	X	3917	COLONEL ELLIS AV	Yard-Back	05/20/2013	Truck 1	Complete Inspection	64	64	0		2
Strawberry	000419SMH	X	501	A FT WILLIAMS PY	Yard-Back	05/14/2013	Truck 1	Complete Inspection	63	64	0		2
Strawberry	001765IN	X	3750	DUKE ST	Sidewalk	07/01/2013	Truck 1	Complete Inspection	62	60	15		3
Strawberry	001893IN	X	52	S FRENCH ST	Easement	06/12/2013	Truck 1	Complete Inspection	62	63	0		2
Strawberry	002048IN	X		WHEELER AVE	Parking Lot	06/11/2013	Truck 1	Complete Inspection	62	63	0		1
Strawberry	000413SMH	X	3700	FT WORTH AV	Light Highway Rural Streets	05/14/2013	Truck 1	Complete Inspection	61	62	0		3
Strawberry	000431SMH	X	3803	COLONEL ELLIS AV	Curb/Gutter	05/17/2013	Truck 1	Complete Inspection	61	62	0		2
Strawberry	000594SMH	X	6	FT WILLIAMS PY	Light Highway Rural Streets	06/27/2013	Truck 1	Complete Inspection	61	62	0		3
Strawberry	000599SMH	X	6	FT WILLIAMS PY	Sidewalk	06/27/2013	Truck 1	Complete Inspection	61	62	0		2
Strawberry	001401IN	X	3901	COLONEL ELLIS AV	Sidewalk	05/20/2013	Truck 1	Complete Inspection	61	62	0		3
Strawberry	002861IN	X	3737	SEMINARY RD	Sidewalk	05/29/2013	Truck 1	Complete Inspection	61	62	0		9
Strawberry	002891IN	X	3729	TEMPLETON PL	Sidewalk	05/17/2013	Truck 1	Complete Inspection	61	62	0		2
Strawberry	000612SMH	X	110	S FLOYD ST	Light Highway Rural Streets	06/27/2013	Truck 1	Complete Inspection	60	61	0		3
Strawberry	000588SMH	X	3812	WHITE POST CT	Curb/Gutter	09/27/2013	Truck 1	Complete Inspection	59	61	0		2
Strawberry	000613SMH	X	110	S FLOYD ST	Light Highway Rural Streets	06/27/2013	Truck 1	Complete Inspection	59	60	0		3
Strawberry	000628SMH	X	34	S FRENCH ST	Light Highway Rural Streets	06/04/2013	Truck 1	Complete Inspection	59	61	0		3
Strawberry	000630SMH	X	10	S FRENCH ST	Light Highway Rural Streets	06/04/2013	Truck 1	Complete Inspection	59	60	0		3
Strawberry	000631SMH	X	2	S FRENCH ST	Light Highway Rural Streets	06/04/2013	Truck 1	Complete Inspection	59	60	0		3
Strawberry	000640SMH	X	2	N FRENCH ST	Sidewalk	06/04/2013	Truck 1	Complete Inspection	59	60	0		3
Strawberry	001813IN	X	97	FENDALL AV	Sidewalk	06/27/2013	Truck 1	Complete Inspection	59	60	0		2
Strawberry	002877IN	X	3905	COLONEL ELLIS AV	Sidewalk	05/20/2013	Truck 1	Complete Inspection	59	60	0		2
Strawberry	001832IN	X	4000	WHEELER AV	Parking Lot	06/12/2013	Truck 1	Complete Inspection	58	49	35		3
Strawberry	000616SMH	X	4000	WHEELER AV	Sidewalk	06/12/2013	Truck 1	Complete Inspection	57	39	35		3
Strawberry	001390IN	X	515	FT WILLIAMS PY	Sidewalk	05/15/2013	Truck 1	Complete Inspection	57	58	0		2
Strawberry	001392IN	X	528	FT WILLIAMS PY	Sidewalk	05/17/2013	Truck 1	Complete Inspection	57	58	0		3
Strawberry	001394IN	X	532	FT WILLIAMS PY	Sidewalk	05/17/2013	Truck 1	Complete Inspection	57	58	0		3
Strawberry	001398IN	X	3805	COLONEL ELLIS AV	Sidewalk	05/20/2013	Truck 1	Complete Inspection	57	58	0		3
Strawberry	002863IN	X	3834	SEMINARY RD	Sidewalk	06/04/2013	Truck 1	Complete Inspection	57	58	0		3

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	002864IN	X	3834	SEMINARY RD	Sidewalk	06/04/2013	Truck 1	Complete Inspection	57	58	0		4
Strawberry	002865IN	X		ST STEPHENS	Easement	05/29/2013	Truck 1	Complete Inspection	57	58	0		2
Strawberry	002874IN	X	3912	COLONEL ELLIS AV	Sidewalk	05/20/2013	Truck 1	Complete Inspection	57	58	0		2
Strawberry	000410SMH	X	4004	FEATHERSTONE PL	Light Highway Rural Streets	05/14/2013	Truck 1	Complete Inspection	56	57	0		3
Strawberry	000412SMH	X	501	FT WILLIAMS PY	Light Highway Rural Streets	05/14/2013	Truck 1	Complete Inspection	56	57	0		3
Strawberry	000626SMH	X	52	S FRENCH ST	Light Highway Rural Streets	06/04/2013	Truck 1	Complete Inspection	56	57	0		4
Strawberry	000629SMH	X	22	S FRENCH ST	Light Highway Rural Streets	06/04/2013	Truck 1	Complete Inspection	56	57	0		3
Strawberry	001282IN	X	3524	SAYLOR PL	Sidewalk	05/15/2013	Truck 1	Complete Inspection	56	57	0		3
Strawberry	001342IN	X	509	FT WILLIAMS PY	Sidewalk	05/15/2013	Truck 1	Complete Inspection	56	56	0		3
Strawberry	001834IN	X	4000	WHEELER AV	Parking Lot	06/12/2013	Truck 1	Complete Inspection	56	38	35		3
Strawberry	000885SMH	X	1109	ST STEPHENS RD	Sidewalk	05/29/2013	Truck 1	Complete Inspection	55	56	0		2
Strawberry	000414SMH	X	501	A FT WILLIAMS PY	Yard-Front	05/14/2013	Truck 1	Complete Inspection	54	55	0		3
Strawberry	001894IN	X	3900	WHEELER AV	Sidewalk	06/27/2013	Truck 1	Complete Inspection	54	55	0		3
Strawberry	000627SMH	X	44	S FRENCH ST	Light Highway Rural Streets	06/04/2013	Truck 1	Complete Inspection	53	54	0		2
Strawberry	001285IN	X	3527	SAYLOR PL	Sidewalk	05/15/2013	Truck 1	Complete Inspection	53	53	0		2
Strawberry	001723IN	X	3901	WHEELER AV	Sidewalk	07/01/2013	Truck 1	Complete Inspection	53	53	0		2
Strawberry	000430SMH	X	528	FT WILLIAMS PY	Yard-Front	05/17/2013	Truck 1	Complete Inspection	52	53	0		3
Strawberry	000432SMH	X	3717	TEMPLETON PL	Yard-Front	05/17/2013	Truck 1	Complete Inspection	52	53	0		2
Strawberry	000582SMH	X	3812	WHITE POST CT	Light Highway Rural Streets	07/01/2013	Truck 1	Complete Inspection	50	51	0		3
Strawberry	000679SMH	X		WHEELER AV	Light Highway Rural Streets	06/11/2013	Truck 1	Complete Inspection	50	51	0		3
Strawberry	002050IN	X		WHEELER AVE	Sidewalk	06/11/2013	Truck 1	Complete Inspection	50	50	0		2
Strawberry	001722IN	X	3901	WHEELER AV	Sidewalk	07/01/2013	Truck 1	Complete Inspection	49	50	0		2
Strawberry	002046IN	X		WHEELER AV	Sidewalk	06/11/2013	Truck 1	Complete Inspection	49	50	0		1
Strawberry	002866IN	X	3937	COLONEL ELLIS AV	Yard-Back	05/29/2013	Truck 1	Complete Inspection	49	50	0		3
Strawberry	002876IN	X	3908	COLONEL ELLIS AV	Sidewalk	05/20/2013	Truck 1	Complete Inspection	49	50	0		2
Strawberry	000615SMH	X	3945	WHEELER AV	Light Highway Rural Streets	06/27/2013	Truck 1	Complete Inspection	47	48	0		4
Strawberry	000892SMH	X	3917	COLONEL ELLIS AV	Yard-Side	05/20/2013	Truck 1	Complete Inspection	47	48	0		2
Strawberry	000887SMH	X	1109	ST STEPHENS RD	Yard-Front	05/29/2013	Truck 1	Complete Inspection	46	46	0		2
Strawberry	001314IN	X	501	FT WILLIAMS PY	Sidewalk	05/14/2013	Truck 1	Complete Inspection	46	43	10		2
Strawberry	000624SMH	X	4100	WHEELER AV	Parking Lot	07/01/2013	Truck 1	Complete Inspection	44	45	0		4
Strawberry	001393IN	X	528	FT WILLIAMS PY	Sidewalk	05/17/2013	Truck 1	Complete Inspection	44	45	0		2
Strawberry	001403IN	X	3701	TEMPLETON PL	Sidewalk	05/17/2013	Truck 1	Complete Inspection	44	45	0		2
Strawberry	001724IN	X	3901	WHEELER AV	Yard-Side	07/01/2013	Truck 1	Complete Inspection	44	45	0		3
Strawberry	001742IN	X	5	FT WILLIAMS PY	Sidewalk	06/27/2013	Truck 1	Complete Inspection	44	45	0		3
Strawberry	001782IN	X	11	S FLOYD ST	Sidewalk	06/27/2013	Truck 1	Complete Inspection	44	45	0		1
Strawberry	001853IN	X	4100	WHEELER AV	Sidewalk	07/01/2013	Truck 1	Complete Inspection	44	45	0		2
Strawberry	001854IN	X	4206	WHEELER AV	Sidewalk	07/01/2013	Truck 1	Complete Inspection	44	45	0		3
Strawberry	001855IN	X	4206	WHEELER AV	Parking Lot	07/01/2013	Truck 1	Complete Inspection	44	45	0		2
Strawberry	001858IN	X		WHEELER AV	Sidewalk	07/01/2013	Truck 1	Complete Inspection	44	45	0		2

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	002043IN	X		GORDON	Sidewalk	06/11/2013	Truck 1	Complete Inspection	44	45	0		1
Strawberry	000604SMH	X	3750	DUKE ST	Easement	07/01/2013	Truck 1	Complete Inspection	43	38	15		2
Strawberry	001402IN	X	3709	TEMPLETON PL	Sidewalk	05/17/2013	Truck 1	Complete Inspection	43	38	15		2
Strawberry	001751IN	X	99	CARRIAGE HOUSE CL	Sidewalk	06/27/2013	Truck 1	Complete Inspection	43	38	15		3
Strawberry	000601SMH	X	1	N DONELSON ST	Light Highway Rural Streets	06/28/2013	Truck 1	Complete Inspection	42	43	0		3
Strawberry	001759IN	X	19	N DONELSON ST	Sidewalk	06/28/2013	Truck 1	Complete Inspection	42	43	0		3
Strawberry	002847IN	X	4001	CARSON PL	Sidewalk	05/29/2013	Truck 1	Complete Inspection	42	38	5		4
Strawberry	002848IN	X	1109	ST STEPHENS RD	Sidewalk	05/29/2013	Truck 1	Complete Inspection	42	43	0		2
Strawberry	000614SMH	X	110	S FLOYD ST	Light Highway Rural Streets	06/27/2013	Truck 1	Complete Inspection	41	42	0		3
Strawberry	001812IN	X	97	FENDALL AV	Yard-Back	06/27/2013	Truck 1	Complete Inspection	41	5	35		1
Strawberry	001750IN	X	99	CARRIAGE HOUSE CL	Easement	06/27/2013	Truck 1	Complete Inspection	40	29	15		2
Strawberry	000118IO	X	48	S EARLY ST	Easement	07/01/2013	Truck 1	Complete Inspection	39	39	0		1
Strawberry	000235ND	X	4001	WHEELER AV	Parking Lot	06/12/2013	Truck 1	Not Inspected - No	37	38	0		2
Strawberry	000417SMH	X	501	A FT WILLIAMS PY	Sidewalk	05/14/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	000498SMH	X	3528	SAYLOR PL	Yard-Side	05/15/2013	Truck 1	Complete Inspection	37	38	0		2
Strawberry	001389IN	X	524	FT WILLIAMS PY	Sidewalk	05/17/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	001744IN	X	5	FT WILLIAMS PY	Sidewalk	06/27/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	001783IN	X	96	FENDALL AV	Sidewalk	06/27/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	001799IN	X	41	S FLOYD ST	Sidewalk	06/27/2013	Truck 1	Complete Inspection	37	38	0		2
Strawberry	001825IN	X	4001	WHEELER AV	Sidewalk	06/12/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	001826IN	X	3950	WHEELER AV	Sidewalk	06/12/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	001828IN	X	4001	WHEELER AV	Sidewalk	06/12/2013	Truck 1	Complete Inspection	37	38	0		2
Strawberry	002044IN	X		GORDON	Sidewalk	06/11/2013	Truck 1	Complete Inspection	37	38	0		2
Strawberry	002045IN	X		WHEELER AV	Sidewalk	06/11/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	002125IN	X	4206	WHEELER AV	Sidewalk	06/11/2013	Truck 1	Complete Inspection	37	38	0		3
Strawberry	002867IN	X		ST STEPHENS	Easement	05/29/2013	Truck 1	Complete Inspection	37	38	0		2
Strawberry	001756IN	X	3757	DUKE ST	Light Highway Rural Streets	06/28/2013	Truck 1	Complete Inspection	33	14	15		2
Strawberry	000421SMH	X	501	FT WILLIAMS PY	Sidewalk	05/15/2013	Truck 1	Complete Inspection	28	29	0		2
Strawberry	000590SMH	X	3700	WHEELER AV	Driveway	07/01/2013	Truck 1	Complete Inspection	28	29	0		3
Strawberry	001811IN	X	97	FENDALL AV	Yard-Back	06/27/2013	Truck 1	Complete Inspection	28	29	0		3
Strawberry	000596SMH	X	99	CARRIAGE HOUSE CL	Easement	06/27/2013	Truck 1	Complete Inspection	27	28	0		2
Strawberry	000598SMH	X	99	CARRIAGE HOUSE CL	Easement	06/27/2013	Truck 1	Complete Inspection	14	14	0		3
Strawberry	001904IN	X	4500	WHEELER AV	Parking Lot	06/27/2013	Truck 1	Complete Inspection	14	14	0		3
Strawberry	000183IO	X	609	FT WILLIAMS PY	Easement	05/20/2013	Truck 1	Complete Inspection	10	10	0		1
Strawberry	000091IO	X	501	A FT WILLIAMS PY	Easement	05/14/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000092IO	X	501	A FT WILLIAMS PY	Easement	05/14/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000093IO	X	501	A FT WILLIAMS PY	Easement	05/14/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000094IO	X	501	A FT WILLIAMS PY	Easement	05/14/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000103IO	X	3516	STERLING AV	Easement	05/15/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000104IO	X	3516	SAYLOR PL	Easement	05/15/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000119IO	X	100	S EARLY ST	Easement	07/01/2013	Truck 1	Complete Inspection	0	0	0		1

Basin	MH	SCREAM Insp	Building No	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	000120IO	X	100	S EARLY ST	Easement	07/01/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000122IO	X	3800	USHER CT	Easement	07/01/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000123IO	X	3731	DUKE ST	Easement	06/27/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000125IO	X	3750	DUKE ST	Easement	06/27/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000130IO	X	4500	WHEELER AV	Easement	06/12/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000133IO	X	4500	WHEELER AV	Easement	07/01/2013	Truck 1	Complete Inspection	0	0	0		0
Strawberry	000134IO	X	4500	WHEELER AV	Easement	06/12/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000135IO	X	4050	WHEELER AV	Easement	06/27/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000169ND	X	3812	WHITE POST CT		07/01/2013	Truck 1	Not Inspected - No	0	0	0		1
Strawberry	000170ND	X	3731	DUKE ST		06/27/2013	Truck 1	Not Inspected - No	0	0	0		0
Strawberry	000208ND	X	511	FT WILLIAMS PY	Easement	05/15/2013	Truck 1	Not Inspected - No	0	0	0		0
Strawberry	000211ND	X	501	A FT WILLIAMS PY		05/14/2013	Truck 1	Not Inspected - No	0	0	0		0
Strawberry	000217ND	X	3757	DUKE ST		07/01/2013	Truck 1	Not Inspected - No	0	0	0		1
Strawberry	000219ND	X	3750	DUKE ST		06/27/2013	Truck 1	Not Inspected - No	0	0	0		0
Strawberry	000227ND	X	1000	ST STEPHENS RD		06/04/2013	Truck 1	Not Inspected - No	0	0	0		0
Strawberry	000499SMH	X	3520	SAYLOR PL	Yard-Back	05/15/2013	Truck 1	Not Inspected - Not	0	0	0		0
Strawberry	000589SMH	X	3700	WHEELER AV	Easement	07/01/2013	Truck 1	Complete Inspection	0	0	0		3
Strawberry	000600SMH	X	3757	DUKE ST		09/27/2013	Truck 1	Complete Inspection	0	0	0		3
Strawberry	000610IO	X	4500	WHEELER AV	Easement	06/11/2013	Truck 1	Complete Inspection	0	0	0		1
Strawberry	000889SMH	X	3834	SEMINARY RD	Yard-Front	05/29/2013	Truck 1	Complete Inspection	0	0	0		3
Strawberry	001768IN	X	3800	USHER CT	Yard-Back	07/01/2013	Truck 1	Complete Inspection	0	0	0		3
Strawberry	001824IN	X	38	S FRENCH ST		06/27/2013	Truck 1	Not Inspected - Not	0	0	0		0
Strawberry	001861IN	X	4206	WHEELER AV	Sidewalk	07/01/2013	Truck 1	Complete Inspection	0	0	0		2
Strawberry	002049IN	X		WHEELER AVE	Parking Lot	06/11/2013	Truck 1	Not Inspected - No	0	0	0		0

Appendix B – Structure Inspection Report
(Includes Defect Detail)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Facility ID

Alexandria - Strawberry Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	0000910	X	501	A FT WILLIAMS PY	Easement	05/14/2013	05/14/2013	Truck 1	1		0	0	0		1
Strawberry	0000920	X	501	A FT WILLIAMS PY	Easement	05/14/2013	05/14/2013	Truck 1	1		0	0	0		1
Strawberry	0000930	X	501	A FT WILLIAMS PY	Easement	05/14/2013	05/14/2013	Truck 1	1		0	0	0		1
Strawberry	0000940	X	501	A FT WILLIAMS PY	Easement	05/14/2013	05/14/2013	Truck 1	1		0	0	0		1
Strawberry	0001030	X	3516	STERLING AV	Easement	05/15/2013	05/15/2013	Truck 1	1		0	0	0		1
Strawberry	0001040	X	3516	SAYLOR PL	Easement	05/15/2013	05/15/2013	Truck 1	1		0	0	0		1
Strawberry	0001180	X	48	S EARLY ST	Easement	07/01/2013	07/01/2013	Truck 1	1		39	39	0		1
				Channel	Cracked	Extreme: >1/4" (6mm) width, pieces, missing				Structural					
				Channel	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching				Structural					
Strawberry	0001190	X	100	S EARLY ST	Easement	07/01/2013	07/01/2013	Truck 1	1		0	0	0		1
Strawberry	0001200	X	100	S EARLY ST	Easement	07/01/2013	07/01/2013	Truck 1	1		0	0	0		1
Strawberry	0001220	X	3800	USHER CT	Easement	07/01/2013	07/01/2013	Truck 1	1		0	0	0		1
Strawberry	0001230	X	3731	DUKE ST	Easement	06/27/2013	06/27/2013	Truck 1	1		0	0	0		1
Strawberry	0001250	X	3750	DUKE ST	Easement	06/27/2013	06/27/2013	Truck 1	1		0	0	0		1
Strawberry	0001300	X	4500	WHEELER AV	Easement	06/12/2013	06/12/2013	Truck 1	1		0	0	0		1
Strawberry	0001330	X	4500	WHEELER AV	Easement	07/01/2013	07/01/2013	Truck 1	1		0	0	0		0
Strawberry	0001340	X	4500	WHEELER AV	Easement	06/12/2013	06/12/2013	Truck 1	1		0	0	0		1
Strawberry	0001350	X	4050	WHEELER AV	Easement	06/27/2013	06/27/2013	Truck 1	1		0	0	0		1
Strawberry	000169ND	X	3812	WHITE POST CT		07/01/2013	07/01/2013	Truck 1	1	No Access	0	0	0		1
Strawberry	000170ND	X	3731	DUKE ST		06/27/2013	06/27/2013	Truck 1	1	No Access	0	0	0		0
Strawberry	0001830	X	609	FT WILLIAMS PY	Easement	05/20/2013	05/20/2013	Truck 1	1		10	10	0		1
				Pipe Connection-1	Pipe cracked	Min: ~1/16" (2mm) width				Structural					
Strawberry	000208ND	X	511	FT WILLIAMS PY	Easement	05/15/2013	05/15/2013	Truck 1	1	No Access	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes																																																																																																																																															
Strawberry	000211ND	X	501	A FT WILLIAMS PY		05/14/2013	05/14/2013	Truck 1	1	No Access	0	0	0		0																																																																																																																																															
Strawberry	000217ND	X	3757	DUKE ST		07/01/2013	07/01/2013	Truck 1	1	No Access	0	0	0		1																																																																																																																																															
Strawberry	000219ND	X	3750	DUKE ST		06/27/2013	06/27/2013	Truck 1	1	No Access	0	0	0		0																																																																																																																																															
Strawberry	000227ND	X	1000	ST STEPHENS RD		06/04/2013	06/04/2013	Truck 1	1	No Access	0	0	0		0																																																																																																																																															
Strawberry	000410SMH	X	4004	FEATHERSTONE PL	Light Highway Rural Streets	05/14/2013	05/14/2013	Truck 1	1		56	57	0		3																																																																																																																																															
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">Cracked / deteriorated</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td style="width: 10%;">Structural</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: <10% mat'l loss, <3/8" (1cm) etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: <10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shft</td> <td>I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: <10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> </table>															Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural											Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural										
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																									
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural																																																																																																																																																									
Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																									
Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																									
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																									
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																									
Strawberry	000412SMH	X	501	FT WILLIAMS PY	Light Highway Rural Streets	05/14/2013	05/14/2013	Truck 1	1		56	57	0		3																																																																																																																																															
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">Corroded, pitted, spalled</td> <td colspan="3">Min: <10% mat'l loss, <3/8" (1cm) etching</td> <td style="width: 10%;">Structural</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: <10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chimney/Shft</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>Cracked</td> <td colspan="3">Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Chamber</td> <td>Corroded, pitted, spalled</td> <td colspan="3">Min: <10% mat'l loss, etching</td> <td>Structural</td> <td colspan="10"></td> </tr> <tr> <td>Pipe Connection-2</td> <td>I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td>I/I</td> <td colspan="10"></td> </tr> </table>															Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural											Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural											Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural											Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I										
Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural																																																																																																																																																									
Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																									
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																									
Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																									
Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural																																																																																																																																																									
Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural																																																																																																																																																									
Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Strawberry	000413SMH	X	3700	FT WORTH AV	Light Highway Rural Streets	05/14/2013	05/14/2013	Truck 1	1		61	62	0		3																																																																																																																																															
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 10%;">Frame Base Seal</td> <td style="width: 10%;">I/I evidence</td> <td colspan="3">Min: <1/4gpm, staining, mineral deposits, flow weeping</td> <td style="width: 10%;">I/I</td> <td colspan="10"></td> </tr> <tr> <td>Frame Base Seal</td> <td>Cracked / deteriorated</td> <td colspan="3">Mod: 1/16"-3/8" (2-10mm) width, small pieces</td> <td>Structural</td> <td colspan="10"></td> </tr> </table>																Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I											Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural																																																																																																																									
Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I																																																																																																																																																									
Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural																																																																																																																																																									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Strawberry	000414SM H	X	501	A FT WILLIAMS PY	Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
					Chimney/Shhaft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shhaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					A FT WILLIAMS PY	Yard-Front	05/14/2013	05/14/2013	Truck 1	1		54	55	0		3
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
Strawberry	000417SM H	X	501	A FT WILLIAMS PY	Chimney/Shhaft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shhaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000419SM H	X	501	A FT WILLIAMS PY	AFT WILLIAMS PY	Sidewalk	05/14/2013	05/14/2013	Truck 1	1		37	38	0		3
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
Strawberry	000419SM H	X	501	A FT WILLIAMS PY	AFT WILLIAMS PY	Yard-Back	05/14/2013	05/14/2013	Truck 1	1		63	64	0		2
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
					Bench	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I							
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Bench	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000421SM H	X	501	FT WILLIAMS PY	Sidewalk	05/15/2013	05/15/2013	Truck 1	1		28	29	0		2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
Strawberry	000430SM H	X	528	FT WILLIAMS PY	Yard-Front	05/17/2013	05/17/2013	Truck 1	1		52	53	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000431SM H	X	3803	COLONEL ELLIS AV	Curb/Gutter	05/17/2013	05/17/2013	Truck 1	1		61	62	0		2
				Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000432SM H	X	3717	TEMPLETON PL	Yard-Front	05/17/2013	05/17/2013	Truck 1	1		52	53	0		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000433SM H	X	519	FT WILLIAMS PY	Easement	05/17/2013	05/17/2013	Truck 1	1		74	75	0		2
				Frame	Offset	Maj: 3" to 4" (7.5-10cm)			Structural						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Steps	Broken / missing / deteriorated	Maj: broken, missing, or deterioration			Structural						
Strawberry	000498SM H	X	3528	SAYLOR PL	Yard-Side	05/15/2013	05/15/2013	Truck 1	1		37	38	0		2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				SAYLOR PL	Yard-Back	05/15/2013	05/15/2013	Truck 1	1	Not found	0	0	0		0
Strawberry	000499SM H	X	3520	WHITE POST CT	Light Highway Rural Streets	07/01/2013	07/01/2013	Truck 1	1		50	51	0		3
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000588SM H	X	3812	WHITE POST CT	Curb/Gutter	09/27/2013	09/27/2013	Truck 1	1		59	61	0		2
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000589SM H	X	3700	WHEELER AV	Easement	07/01/2013	07/01/2013	Truck 1	1		0	0	0		3
Strawberry	000590SM H	X	3700	WHEELER AV	Driveway	07/01/2013	07/01/2013	Truck 1	1		28	29	0		3
Strawberry				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				FT WILLIAMS PY	Light Highway Rural Streets	06/27/2013	06/27/2013	Truck 1	1		61	62	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Bench	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
				Bench	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000596SM H	X	99	CARRIAGE HOUSE CL	Easement	06/27/2013	06/27/2013	Truck 1	1		27	28	0		2
Strawberry				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				CARRIAGE HOUSE CL	Easement	06/27/2013	06/27/2013	Truck 1	1		14	14	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
Strawberry	000599SM H	X	6	FT WILLIAMS PY	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		61	62	0		2	
	Frame	Offset	Mod: 2" to 3" (5-7.5cm)			Structural										
	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural										
	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural										
	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I										
	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural										
	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural										
	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I										
Strawberry	000600SM H	X	3757	DUKE ST		09/27/2013	09/27/2013	Truck 1	1		0	0	0		3	
Strawberry	000601SM H	X	1	N DONELSON ST	Light Highway Rural Streets	06/28/2013	06/28/2013	Truck 1	1		42	43	0		3	
Strawberry	000604SM H	X	3750	DUKE ST	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
					Chamber	Mortar missing	Min: <10% of area			Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Easement		07/01/2013	07/01/2013	Truck 1	1		43	38	15		2
Strawberry	000609SM H	X	97	FENDALL AV	Yard-Side	06/27/2013	06/27/2013	Truck 1	1		67	39	50		3	
						Frame	Offset	Min: 7/8" to 2" (2.5-5cm)			Structural					
						Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
						Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
						Channel	Debris/deposition	Extreme: >5 gal bucket			Maintenance					
Strawberry	000610IO	X	4500	WHEELER AV	Easement	06/11/2013	06/11/2013	Truck 1	1		0	0	0		1	
Strawberry	000612SM H	X	110	S FLOYD ST	Light Highway Rural Streets	06/27/2013	06/27/2013	Truck 1	1		60	61	0		3	
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	Mortar missing	Min: <10% of area		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000613SM H	X	110	S FLOYD ST	Light Highway Rural Streets	06/27/2013	06/27/2013	Truck 1	1		59	60	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chimney/Shft	Mortar missing	Min: <10% of area		Structural							
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Mortar missing	Min: <10% of area		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000614SM H	X	110	S FLOYD ST	Light Highway Rural Streets	06/27/2013	06/27/2013	Truck 1	1		41	42	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	000615SM H	X	3945	WHEELER AV	Light Highway Rural Streets	06/27/2013	06/27/2013	Truck 1	1		47	48	0		4
				Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
Strawberry	000616SM H	X	4000	WHEELER AV	Sidewalk	06/12/2013	06/12/2013	Truck 1	1		57	39	35		3
					Frame	Offset	Min: 7/8" to 2" (2.5-cm)		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenance						
Strawberry	000624SM H	X	4100	WHEELER AV	Parking Lot	07/01/2013	07/01/2013	Truck 1	1		44	45	0		4
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	000626SM H	X	52	S FRENCH ST	Light Highway Rural Streets	06/04/2013	06/04/2013	Truck 1	1		56	57	0		4
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	000627SM H	X	44	S FRENCH ST	Light Highway Rural Streets	06/04/2013	06/04/2013	Truck 1	1		53	54	0		2
					Frame	Offset	Min: 7/8" to 2" (2.5-cm)		Structural						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000628SM	X	34	S FRENCH ST	Light Highway Rural Streets	06/04/2013	06/04/2013	Truck 1	1		59	61	0		3
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000629SM	X	22	S FRENCH ST	Light Highway Rural Streets	06/04/2013	06/04/2013	Truck 1	1		56	57	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000630SM	X	10	S FRENCH ST	Light Highway Rural Streets	06/04/2013	06/04/2013	Truck 1	1		59	60	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chimney/Shift	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shift	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shift	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000631SM H	X	2	S FRENCH ST	Light Highway Rural Streets	06/04/2013	06/04/2013	Truck 1	1		59	60	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shift	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shift	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shift	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000640SM H	X	2	N FRENCH ST	Sidewalk	06/04/2013	06/04/2013	Truck 1	1		59	60	0		3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chimney/Shift	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shift	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shift	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	000679SM H	X		WHEELER AV	Light Highway Rural Streets	06/11/2013	06/11/2013	Truck 1	1		50	51	0		3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
Strawberry	000885SM	X H	1109	ST STEPHENS RD	Sidewalk	05/29/2013	05/29/2013	Truck 1	1		55	56	0		2
					Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
Strawberry	000887SM	X H	1109	ST STEPHENS RD	Yard-Front	05/29/2013	05/29/2013	Truck 1	1		46	46	0		2
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	000889SM	X H	3834	SEMINARY RD	Yard-Front	05/29/2013	05/29/2013	Truck 1	1		0	0	0		3
Strawberry	000891SM	X H	3929	COLONEL ELLIS AV	Yard-Back	05/29/2013	05/29/2013	Truck 1	1		66	67	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	000892SMXH	3917	COLONEL ELLIS AV	Yard-Side	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-1	Pipe cracked	Min: ~1/16" (2mm) width	Structural							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
Strawberry	001282INX	3524	SAYLOR PL	Sidewalk	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
Strawberry	001285INX	3527	SAYLOR PL	Sidewalk	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-1	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I							
					Pipe Connection-1	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width	Structural							
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-3	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
Strawberry	001285INX	3527	SAYLOR PL	Sidewalk	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I							
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001314IN	X	501	FT WILLIAMS PY	Sidewalk	05/14/2013	05/14/2013	Truck 1	1		46	43	10		2
				Chamber	Roots Intrusion	Min: ~1/16" to 1/8" (2-3mm) dia., fingers, small mass		Maintenance							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001342IN	X	509	FT WILLIAMS PY	Sidewalk	05/15/2013	05/15/2013	Truck 1	1		56	56	0		3
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001389IN	X	524	FT WILLIAMS PY	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		37	38	0		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001390IN	X	515	FT WILLIAMS PY	Sidewalk	05/15/2013	05/15/2013	Truck 1	1		57	58	0		2
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001392IN	X	528	FT WILLIAMS PY	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		57	58	0		3
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001393IN	X	528	FT WILLIAMS PY	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		44	45	0		2
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	001394IN	X	532	FT WILLIAMS PY	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		57	58	0		3
					Chamber	Cracked		Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural						
					Chamber	Corroded, pitted, spalled		Mod:10-25% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
Strawberry	001398IN	X	3805	COLONEL ELLIS AV	Sidewalk	05/20/2013	05/20/2013	Truck 1	1		57	58	0		3
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-2	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-2	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
					Pipe Connection-3	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-3	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
Strawberry	001401IN	X	3901	COLONEL ELLIS AV	Sidewalk	05/20/2013	05/20/2013	Truck 1	1		61	62	0		3
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-1	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-1	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
					Pipe Connection-2	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-2	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
					Pipe Connection-3	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-3	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
Strawberry	001402IN	X	3709	TEMPLETON PL	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		43	38	15		2
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Channel	Debris/deposition		Mod: 1-3gal bucket	Maintenance						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	001403IN	X	3701	TEMPLETON PL	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		44	45	0		2
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
Strawberry	001722IN	X	3901	WHEELER AV	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		49	50	0		2
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Pipe Connection-1	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
Strawberry	001723IN	X	3901	WHEELER AV	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		53	53	0		2
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Pipe Connection-1	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
					Pipe Connection-2	Pipe cracked		Min: ~1/16" (2mm) width	Structural						
Strawberry	001724IN	X	3901	WHEELER AV	Yard-Side	07/01/2013	07/01/2013	Truck 1	1		44	45	0		3
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
Strawberry	001742IN	X	5	FT WILLIAMS PY	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		44	45	0		3
					Chamber	Cracked		Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						
Strawberry	001744IN	X	5	FT WILLIAMS PY	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		37	38	0		3
					Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
					Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching	Structural						
					Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	001750IN	X	99	CARRIAGE HOUSE CL	Easement	06/27/2013	06/27/2013	Truck 1	1		40	29	15		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance							
Strawberry	001751IN	X	99	CARRIAGE HOUSE CL	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		43	38	15		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance							
Strawberry	001756IN	X	3757	DUKE ST	Light Highway Rural Streets	06/28/2013	06/28/2013	Truck 1	1		33	14	15		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
				Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance							
Strawberry	001759IN	X	19	N DONELSON ST	Sidewalk	06/28/2013	06/28/2013	Truck 1	1		42	43	0		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	Mortar missing	Min: <10% of area		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001765IN	X	3750	DUKE ST	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		62	60	15		3
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural							
				Chamber	Mortar missing	Min: <10% of area		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Bench	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Bench	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural							
				Channel	Debris/deposition	Mod: 1-3gal bucket		Maintenance							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	001768IN	X	3800	USHER CT	Yard-Back	07/01/2013	07/01/2013	Truck 1	1		0	0	0		3
Strawberry	001782IN	X	11	S FLOYD ST	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		44	45	0		1
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Strawberry	001783IN	X	96	FENDALL AV	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		37	38	0		3
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
Strawberry	001799IN	X	41	S FLOYD ST	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		37	38	0		2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	001811IN	X	97	FENDALL AV	Yard-Back	06/27/2013	06/27/2013	Truck 1	1		28	29	0		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
Strawberry	001812IN	X	97	FENDALL AV	Yard-Back	06/27/2013	06/27/2013	Truck 1	1		41	5	35		1
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Channel	Debris/deposition	Maj: 3-5gal bucket			Maintenance						
Strawberry	001813IN	X	97	FENDALL AV	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		59	60	0		2
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)			Structural						
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
				Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
				Chamber	Mortar missing	Min: <10% of area			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
Strawberry	001824IN	X	38	S FRENCH ST		06/27/2013	06/27/2013	Truck 1	1	Not found	0	0	0		0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	001825IN	X	4001	WHEELER AV	Sidewalk	06/12/2013	06/12/2013	Truck 1	1		37	38	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	001826IN	X	3950	WHEELER AV	Sidewalk	06/12/2013	06/12/2013	Truck 1	1		37	38	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	001828IN	X	4001	WHEELER AV	Sidewalk	06/12/2013	06/12/2013	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenance						
Strawberry	001832IN	X	4000	WHEELER AV	Parking Lot	06/12/2013	06/12/2013	Truck 1	1		58	49	35		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenance						
Strawberry	001834IN	X	4000	WHEELER AV	Parking Lot	06/12/2013	06/12/2013	Truck 1	1		56	38	35		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Channel	Debris/deposition	Maj: 3-5gal bucket		Maintenance						
Strawberry	001847IN	X	4001	WHEELER AV	Parking Lot	06/12/2013	06/12/2013	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	001853IN	X	4100	WHEELER AV	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		44	45	0		2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001854IN	X	4206	WHEELER AV	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		44	45	0		3
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001855IN	X	4206	WHEELER AV	Parking Lot	07/01/2013	07/01/2013	Truck 1	1		44	45	0		2
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001858IN	X		WHEELER AV	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		44	45	0		2
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001861IN	X	4206	WHEELER AV	Sidewalk	07/01/2013	07/01/2013	Truck 1	1		0	0	0		2
Strawberry	001893IN	X	52	S FRENCH ST	Easement	06/12/2013	06/12/2013	Truck 1	1		62	63	0		2
				Frame	Offset	Mod: 2" to 3" (5-7.5cm)		Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	001894IN	X	3900	WHEELER AV	Sidewalk	06/27/2013	06/27/2013	Truck 1	1		54	55	0		3
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-3	Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width		Structural						
Strawberry	001904IN	X	4500	WHEELER AV	Parking Lot	06/27/2013	06/27/2013	Truck 1	1		14	14	0		3
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
Strawberry	002043IN	X		GORDON	Sidewalk	06/11/2013	06/11/2013	Truck 1	1		44	45	0		1
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002044IN	X		GORDON	Sidewalk	06/11/2013	06/11/2013	Truck 1	1		37	38	0		2
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002045IN	X		WHEELER AV	Sidewalk	06/11/2013	06/11/2013	Truck 1	1		37	38	0		3
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002046IN	X		WHEELER AV	Sidewalk	06/11/2013	06/11/2013	Truck 1	1		49	50	0		1
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002048IN	X		WHEELER AVE	Parking Lot	06/11/2013	06/11/2013	Truck 1	1		62	63	0		1
					Frame Base Seal	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching		Structural						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	002049IN	X		WHEELER AVE	Parking Lot	06/11/2013	06/11/2013	Truck 1	1	No Access	0	0	0		0
Strawberry	002050IN	X		WHEELER AVE	Sidewalk	06/11/2013	06/11/2013	Truck 1	1		50	50	0		2
				Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural							
				Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	002125IN	X	4206	WHEELER AV	Sidewalk	06/11/2013	06/11/2013	Truck 1	1		37	38	0		3
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	002847IN	X	4001	CARSON PL	Sidewalk	05/29/2013	05/29/2013	Truck 1	1		42	38	5		4
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Channel	Debris/deposition	Min: <1gal bucket		Maintenance							
Strawberry	002848IN	X	1109	ST STEPHENS RD	Sidewalk	05/29/2013	05/29/2013	Truck 1	1		42	43	0		2
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	002861IN	X	3737	SEMINARY RD	Sidewalk	05/29/2013	05/29/2013	Truck 1	1		61	62	0		9
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural							
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							
				Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I							
Strawberry	002863IN	X	3834	SEMINARY RD	Sidewalk	06/04/2013	06/04/2013	Truck 1	1		57	58	0		3
				Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	002864IN	X	3834	SEMINARY RD	Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Sidewalk	06/04/2013	06/04/2013	Truck 1	1		57	58	0		4
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					ST STEPHENS	Easement	05/29/2013	05/29/2013	Truck 1	1		57	58	0	2
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
Strawberry	002865IN	X		COLONEL ELLIS AV	Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Yard-Back	05/29/2013	05/29/2013	Truck 1	1		49	50	0		3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					ST STEPHENS	Easement	05/29/2013	05/29/2013	Truck 1	1		37	38	0	2
Strawberry	002867IN	X		COLONEL ELLIS AV	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Yard-Back	05/20/2013	05/20/2013	Truck 1	1		69	70	0		3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002870IN	X	3929	COLONEL ELLIS AV	Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-2	Pipe cracked	Extreme: >1/4" (6mm) width, pieces, missing		Structural						
					Pipe Connection-3	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	002871IN	X	3917	COLONEL ELLIS AV	Yard-Back	05/20/2013	05/20/2013	Truck 1	1		64	64	0		2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-2	I/I evidence	Maj: 3-10gpm, streaming, flow running		I/I						
Strawberry	002874IN	X	3912	COLONEL ELLIS AV	Sidewalk	05/20/2013	05/20/2013	Truck 1	1		57	58	0		2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
					Pipe Connection-2	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-2	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
Strawberry	002875IN	X	3913	COLONEL ELLIS AV	Sidewalk	05/20/2013	05/20/2013	Truck 1	1		76	77	0		3
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	Pipe cracked	Min: ~1/16" (2mm) width		Structural						
					Pipe Connection-2	I/I evidence	Extreme: >10gpm, flow gushing		I/I						
					Pipe Connection-3	I/I evidence	Maj: 3-10gpm, streaming, flow running		I/I						
Strawberry	002876IN	X	3908	COLONEL ELLIS AV	Sidewalk	05/20/2013	05/20/2013	Truck 1	1		49	50	0		2
					Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
Strawberry	002877IN	X	3905	COLONEL ELLIS AV	Sidewalk	05/20/2013	05/20/2013	Truck 1	1		59	60	0		2
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002891IN	X	3729	TEMPLETON PL	Sidewalk	05/17/2013	05/17/2013	Truck 1	1		61	62	0		2
					Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~ 3/8" (1cm)		Structural						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I						
Strawberry	002896IN	X	3729	TEMPLETON PL	Easement	05/17/2013	05/17/2013	Truck 1	1		70	69	5		1
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Chamber	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Chamber	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching		Structural						
					Bench	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Bench	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Channel	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing		Structural						
					Channel	Corroded, pitted, spalled	Extreme: >50% mat'l loss, >3/4" (2cm) etching		Structural						
					Channel	Debris/deposition	Min: <1gal bucket		Maintenance						

Appendix C – Summary of Structures Not Inspected

Facility ID	Why Not Inspected
000235ND	Not Inspected - No Access
000169ND	Not Inspected - No Access
000170ND	Not Inspected - No Access
000208ND	Not Inspected - No Access
000211ND	Not Inspected - No Access
000217ND	Not Inspected - No Access
000219ND	Not Inspected - No Access
000227ND	Not Inspected - No Access
002049IN	Not Inspected - No Access
000499SMH	Not Inspected - Not found
001824IN	Not Inspected - Not found

Appendix D - Summary of Observed Pipe Defects

SCREAM Lamping - Summary of Observed Defects

Alexandria - Strawberry Run

Pipe	SCREAM Total Score	US MH Bldg	MH Street	Observed		Inventory	Maintenance	Structural		
				Infiltration	Information	Debris	Broken pieces	Crack	Displaced	
				Infiltration (Count)	General Remark (Count)	Debris (Length)	Broken, Pieces (Count)	Cracks Multiple (Length)	Displaced (Count)	
002868IN-000891SMH	7	3933	COLONEL ELLIS AV	1	0	0	0	0	0	0
000891SMH-002870IN	7	3929	COLONEL ELLIS AV	1	0	0	0	0	0	0
002847IN-002848IN	7	4001	CARSON PL	1	0	0	0	0	0	0
002878IN-001401IN	7	1004	HARDEE PL	1	0	0	0	0	0	0
001278IN-001282IN	7	3520	SAYLOR PL	1	0	0	0	0	0	0
000498SMH-001285IN	7	3528	SAYLOR PL	1	0	0	0	0	0	0
002876IN-002877IN	7	3908	COLONEL ELLIS AV	1	0	0	0	0	0	0
000892SMH-002875IN	7	3917	COLONEL ELLIS AV	1	0	0	0	0	0	0
002871IN-000892SMH	7	3917	COLONEL ELLIS AV	1	0	0	0	0	0	0
001398IN-000431SMH	7	3805	COLONEL ELLIS AV	1	0	0	0	0	0	0
001314IN-000412SMH	7	3701	FT WORTH AV	1	0	0	0	0	0	0
000410SMH-	7	4008	FEATHERSTONE PL	1	0	0	0	0	0	0
000419SMH-000094IO	7	4008	FEATHERSTONE PL	1	0	0	0	0	0	0
000421SMH-001314IN	7	501	FT WILLIAMS PY	1	0	0	0	0	0	0
000613SMH-	7	53	FLOYD ST	1	0	0	0	0	0	0
000614SMH-	7	53	FLOYD ST	1	0	0	0	0	0	0
002870IN-002871IN	8	3929	COLONEL ELLIS AV	2	0	0	0	0	0	0
002866IN-000891SMH	8	3937	COLONEL ELLIS AV	2	0	0	0	0	0	0
001894IN-001904IN	9	3945	WHEELER AV	0	0	0	0	4	0	0
001724IN-001723IN	9	100	EARLY ST	0	0	0	0	4	0	0
001723IN-001722IN	12	100	EARLY ST	0	0	0	0	8	0	0
002873IN-002875IN	17	3921	COLONEL ELLIS AV	1	0	0	0	4	0	0
002874IN-002876IN	17	3912	COLONEL ELLIS AV	1	0	0	0	4	0	0
002877IN-001401IN	17	3905	COLONEL ELLIS AV	1	0	0	0	4	0	0
002875IN-002874IN	18	3913	COLONEL ELLIS AV	2	0	0	0	4	0	0
001401IN-001398IN	22	3901	COLONEL ELLIS AV	2	0	0	0	8	0	0
001282IN-000499SMH	24	3524	SAYLOR PL	2	0	0	0	0	0	0
001285IN-001282IN	32	3528	SAYLOR PL	3	0	0	0	4	0	0
000885SMH-	47	1109	ST STEPHENS RD	1	0	4	0	4	1	
002889IN-002870IN	60	3830	SEMINARY RD	0	0	0	1	0	0	0
Total				33	23	4	1	48	1	

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when scored. Note that this occurs across merged inspections. See the inspection for more information.